

# Work Order ID 73655

Monday, September 12, 2011 2:26:46 PM

Page 1

Item ID: D206-667-103

Accept

Revision ID:

Item Name: Crosstube Fwd

Start Date: 9/9/2011 Start Qty: 1.00

Required Date: 9/23/2011 Req'd Qty: 1.00

Reference: **REWORK**

Cust Item ID:

Customer:

Approvals: Process Plan: *mf*

Date: *1-09-12* Tooling:

Date:

QC:

Date: SPC (Y/N):

Date:

Run Start

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr Revision Nbr

D206-667-143 Rev C (DEO)

DSI9565 A

290

0.00



Crosstubes

Memo

0.00

Crosstubes

PULL FROM STOCK D206-667-103  
B#38508

-REMOVE SUPPORTS

-REMOVE CLAMPS AND ABRASION STRIPS AND DISCARD

295

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

*S u l o r t y*

*11 09 13*

<b>DART</b> Dart Aerospace Ltd. 1270 ABERDEEN ST. HAWKESBURY, ONT CANADA K6A 1K7				TC APPROVAL # 09-89 TEL: 1-613-632-5200	
PN	D206-667-103	CHG	CHG002		
DESC.	Crosstube Fwd High	STC	SH01-5		
LOT	B38508	STC	SR01304NY		
MODEL	Bell 206L/L1/L3/L4	STC			
MADE IN CANADA					

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 73655

Monday, September 12, 2011 2:26:46 PM

Page 2

Item ID: D206-667-103

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Fwd

Start Date: 9/9/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 9/23/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start

QC: Date: SPC (Y/N): Date:

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

300

Spray Painting per QSI005 4.2

0.00



SprayPaint

Memo

0.00

Spray Painting

SCUFF AND REPAINT TUBE AS NECESSARY PER QSI 005

11 09 14 ①

310

QC14- Inspect Spray Paint

0.00



QC

Memo

0.00

Quality Control

N/A S

Pick kit

11 09 14 ①

320

0.00



Crosstubes

Memo

0.00

Crosstubes

RE-ASSEMBLE USING SUPPORTS THAT WERE REWORKED TO NEW  
CHANGE NUMBER AND USE NEW HARDWARE

-ADD QTY 12 AN970-4 WASHERS ( PER NOW SUPERCEDED DSI 9430  
REV A)

11 09 20 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 73655

Monday, September 12, 2011 2:26:46 PM

Page 3

Item ID: D206-667-103

Accept

Revision ID:

Item Name: Crosstube Fwd

Start Date: 9/9/2011 Start Qty: 1.00

Required Date: 9/23/2011 Req'd Qty: 1.00

Reference:

Cust Item ID:

Customer:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start

Stop

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

330

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

*Suloriz*

350



Packaging

Packaging

Memo

ID AND STOCK UNDER NEW BATCH NUMBER AND NEW CHANGE  
NUMBER @ 5  
-ADD NEW PAPERWORK

0.00

0.00

*63*

*11/9/2011*

*Rev E*

360



QC

Quality Control

QC4- 100% Inspect kits for completeness

0.00

Memo

0.00

*CHG 205*

*Suloriz*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 73655

Monday, September 12, 2011 2:26:46 PM



Page 4

Item ID: D206-667-103

Accept



Setup Start



Revision ID:

Item Name: Crosstube Fwd

Stop



Start Date: 9/9/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 9/23/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop



Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

360

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

11/9/22

mf  
11-09-22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



# Picklist Print

Monday, September 12, 2011 2:26:44 PM

Page 1

Work Order ID: 73655

Parent Item: D206-667-103

Parent Item Name: Crosstube Fwd

Start Date: 9/9/2011

Required Date: 9/23/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:F 05.09.01 Add holes for compatibility with Bell Skidtubes KJ/JLM  
 IPP Rev:G 08-06-03 update as per DSI9415 (ECN1198) DD verified by:  
 IPP Rev: H 08.11.17 QC5 was QC6 at step 12 KJ verified by: EC  
 IPP Rev:I 08-12-15 add magnobond DD verified by:EC  
 IPP Rev J 09.01.06 ECN 08-562 EC verified by: DD  
 IPP Rev:K 09-01-19 as per DSI9439 DD verified by:EC IPP REV:L  
 11.08.05 PER ECN 11-615 DD VERF:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

AN970-4

Purchased

No

Each

224.0000

12



Washer

Location

Loc Qty

Loc Code

ST342

212

117795

212

ST344

11

115936

11

ST349

1

116900

1

D2891-1

Manufactured

No

Each

21.0000

2



2.25 Support

Location

Loc Qty

Loc Code

LG

15

28792

2

71991

13

LG052

6

34062

6

B# 73668

12

11.09.20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

Monday, September 12, 2011 2:26:44 PM

Page 2

Work Order ID: 73655



Parent Item: D206-667-103



Parent Item Name: Crosstube Fwd

Start Date: 9/9/2011

Required Date: 9/23/2011

Start Qty: 1.00

Required Qty: 1.00

MS21920-20

Purchased

No

Each

82.0000

2



Clamp (per MIL-DTL-8783C)

*11-09-10*

Location

Loc Qty

Loc Code

LG050

82

116799

10

118236

26

118649

46

Rubber Cushion = D3595-063-395 B# 70975

*11 09 20 x4*

Monday, September 12, 2011 2:26:44 PM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 10/04/2008 12:04:24 PM  
User: Linda Lacelle

**Process Sheet**

Customer : CC-DAR01 Dart Aerospace Ltd.  
Job Number : 38508  
Estimate Number : 10804  
P.O. Number :  
This Issue : 10/04/2008 S.O. No. :  
Prsht Rev. : NC  
First Issue : 10/04/2008 Type : CROSSTUBES  
Previous Run : 35515  
Written By : W  
Checked & Approved By : W  
Comment :

Drawing Name : D206-667-103A

Part Number : D206667103A  
Drawing Number : REWORK-ARM.SHIELD  
Project Number :  
Drawing Revision :  
Material :  
Due Date : 30/04/2008 Qty: 1 Um: Each

**Additional Product**

Job Number:



<b>DART</b>			
TRANSPORT CANADA APPROVAL C-09-69			
TEL: 1-613-632-3336	FAX: 1-613-632-4443		
P/N	D206-667-103A	CHG	CHG001
DESC	Crosstube Fwd High	STC	SH01-5
LOT	B33933	STC	SR01304NY
MODEL	Bell 206L/L1/L3/L4	STC	
MADE IN CANADA			

Seq. #: Machine Or Operation: Description :

1.0 CROSSTUBES CROSSTUBES RESOURCE 1



Comment: CROSSTUBES RESOURCE 1

RTN FROM OFFSHORE INVENTORY  
1 X D206-667-103A B 33933

CHG001

*Handwritten signature and date 8/4/17*

2.0 D206667103A Crosstube Installation W/ armour shield



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
Crosstube Installation W/ armour shield  
B/N 33933

3.0 SPRAY PAINTING SPRAY PAINTING



Comment: REMOVE SUPPORTS, CLAMPS AND HARWARE

DISCARD HARDWARE IF NO GOOD

KEEP CLAMPS AND SUPPORTS TO  
REASSEMBLE

STRIP TUBE COMPLETELY TO  
REMOVE ARMOR SHIELD

*Handwritten note: ml 08 04 22 ①*

Date: Thursday, 7/19/2007 2:28:57 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 33685

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description:

24.0

D2873045

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part number

Description Batch

2 D2873-045

Nut Plate

32164

RT 07-08-16

25.0

D28911

Support 2.25 dia



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part number

Description Batch

2 D2891-1

Support

287912

ml 07 08 18

26.0

MS20601AD4W8

RIVET



Comment: Qty.: 14.0000 Each(s)/Unit Total: 14.0000 Each(s)

Pick:

Qty Part number

Description Batch

14 MS20601AD4W8 Rivet

102870

RT 07-08-16

27.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:

Qty Part number

Description Batch

4 MS21920-20

Clamp

104902

ml 07 08 18

28.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install abrasion strips as per QSI 035 using DT8579. Note: (2) Aft holes should be facing up.

2-Install supports and clamps as per Dwg D4206-667-143. Torque clamps to 80-100 in lb

3-Install nut plates as per Dwg D206-667-143. Touch-up rivet heads with Imron paint.

ml 07 08 18

RT 07-08-16

Item	Qty -143	Part Number	Description
1	X	D206-667-143	CROSSTUBE ASSEMBLY (206L HIGH FWD)
2	1	D6002-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)


#### GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6002-115  
FINISHED LENGTH = 104.98±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-143" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 15.5 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.


ECO #1-615  
11.07.28  
**UNDER REVIEW**  
9/11/08/13

**DEO ATTACHED RELEASED**  
08/11/12 MRP

C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-395 WAS D2856-400-694 (ZN D6-2 & A5-2); REMOVED REF. & ADD TOLERANCE (ZN D3-3, C4-3, C5-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	00.11.17
REV.	DESCRIPTION	BY	DATE
DESIGN	9P	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF	DRAWING NO.	REV. C
CHECKED	4P	D206-667-143	SHEET 1 OF 4
MFG. APPR.	4P	TITLE	SCALE
APPROVED	4P	CROSSTUBE ASS'Y (206L HIGH FWD)	NTS
DE APPR.	4P	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DATE	08.11.06		

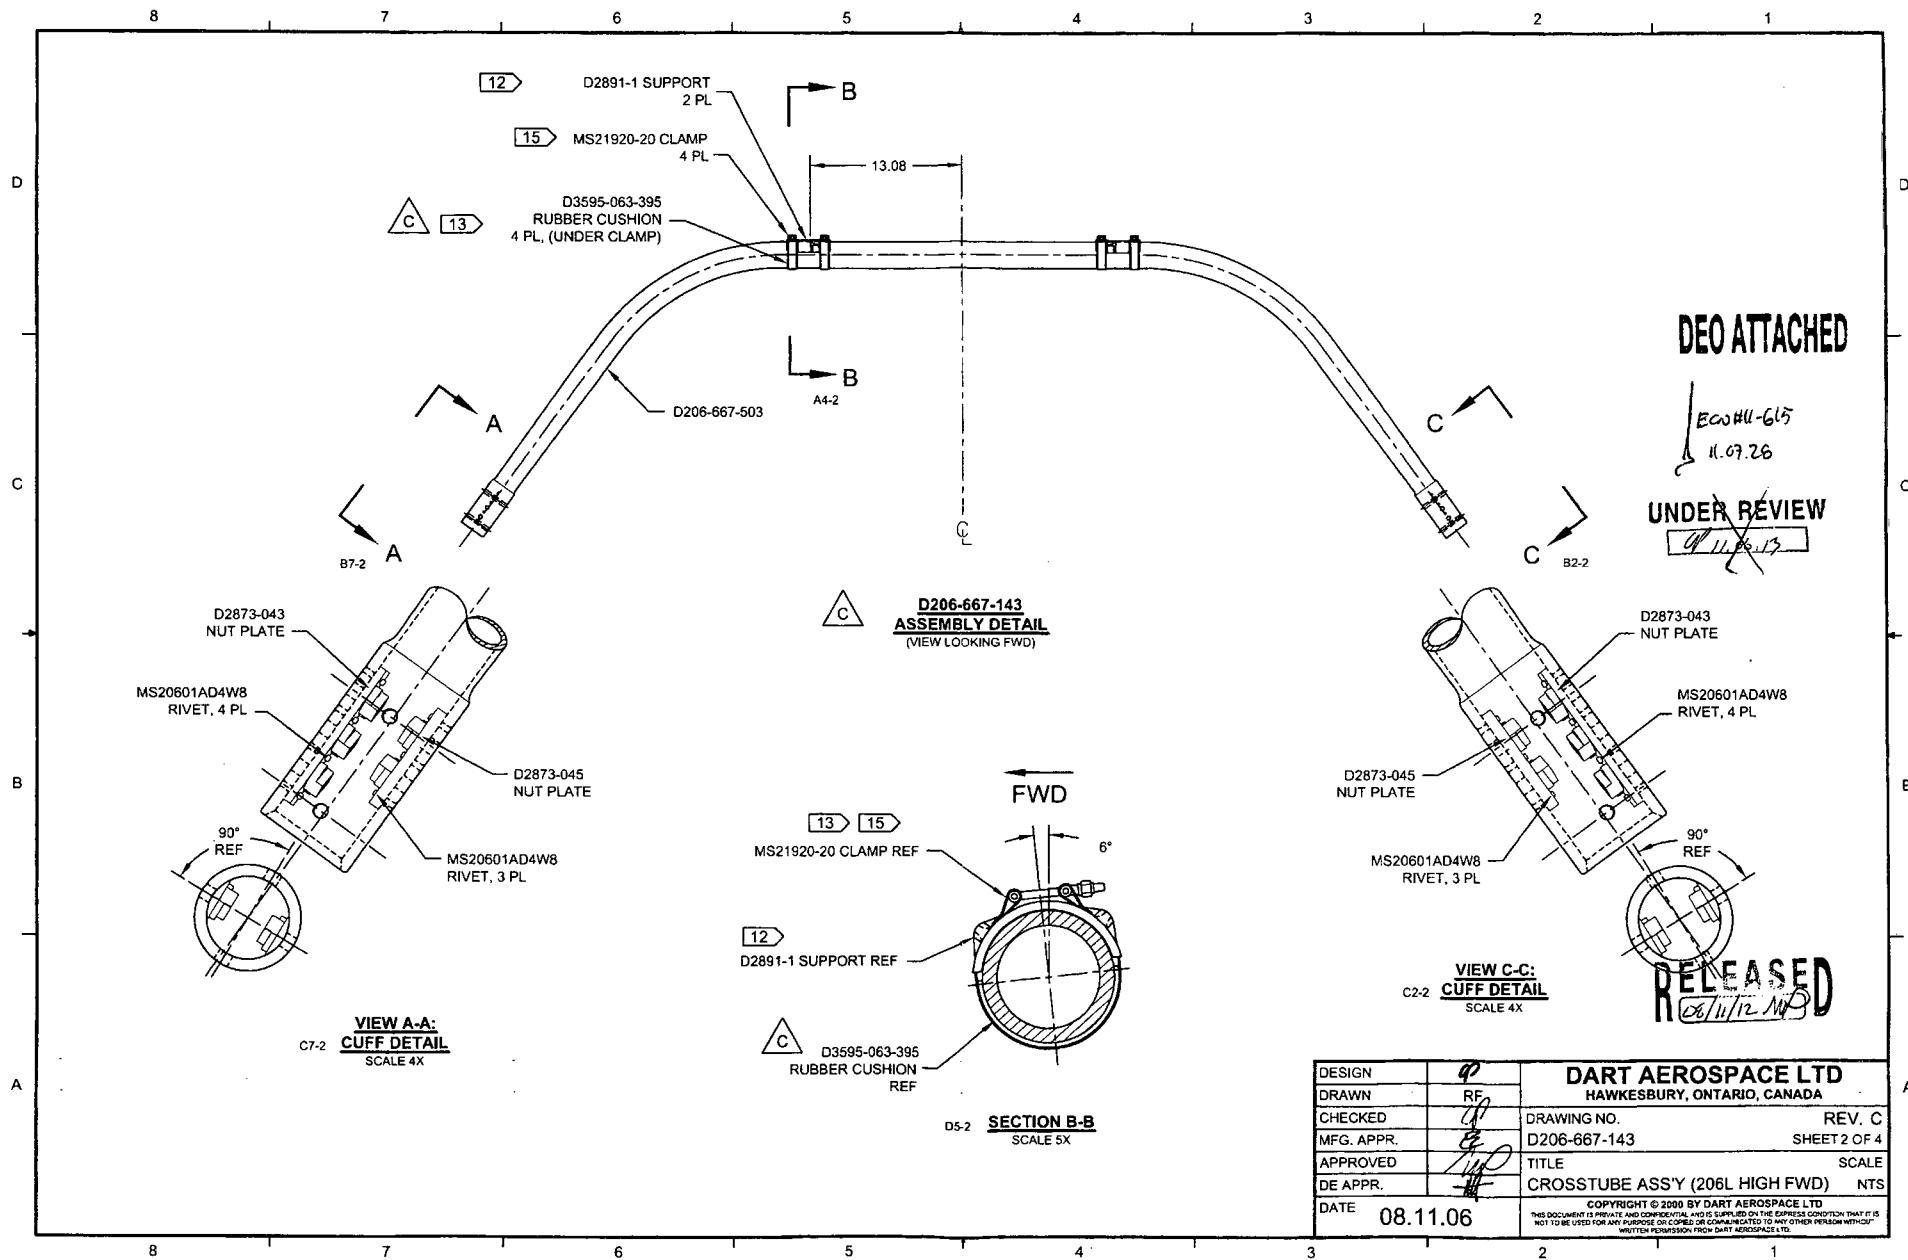



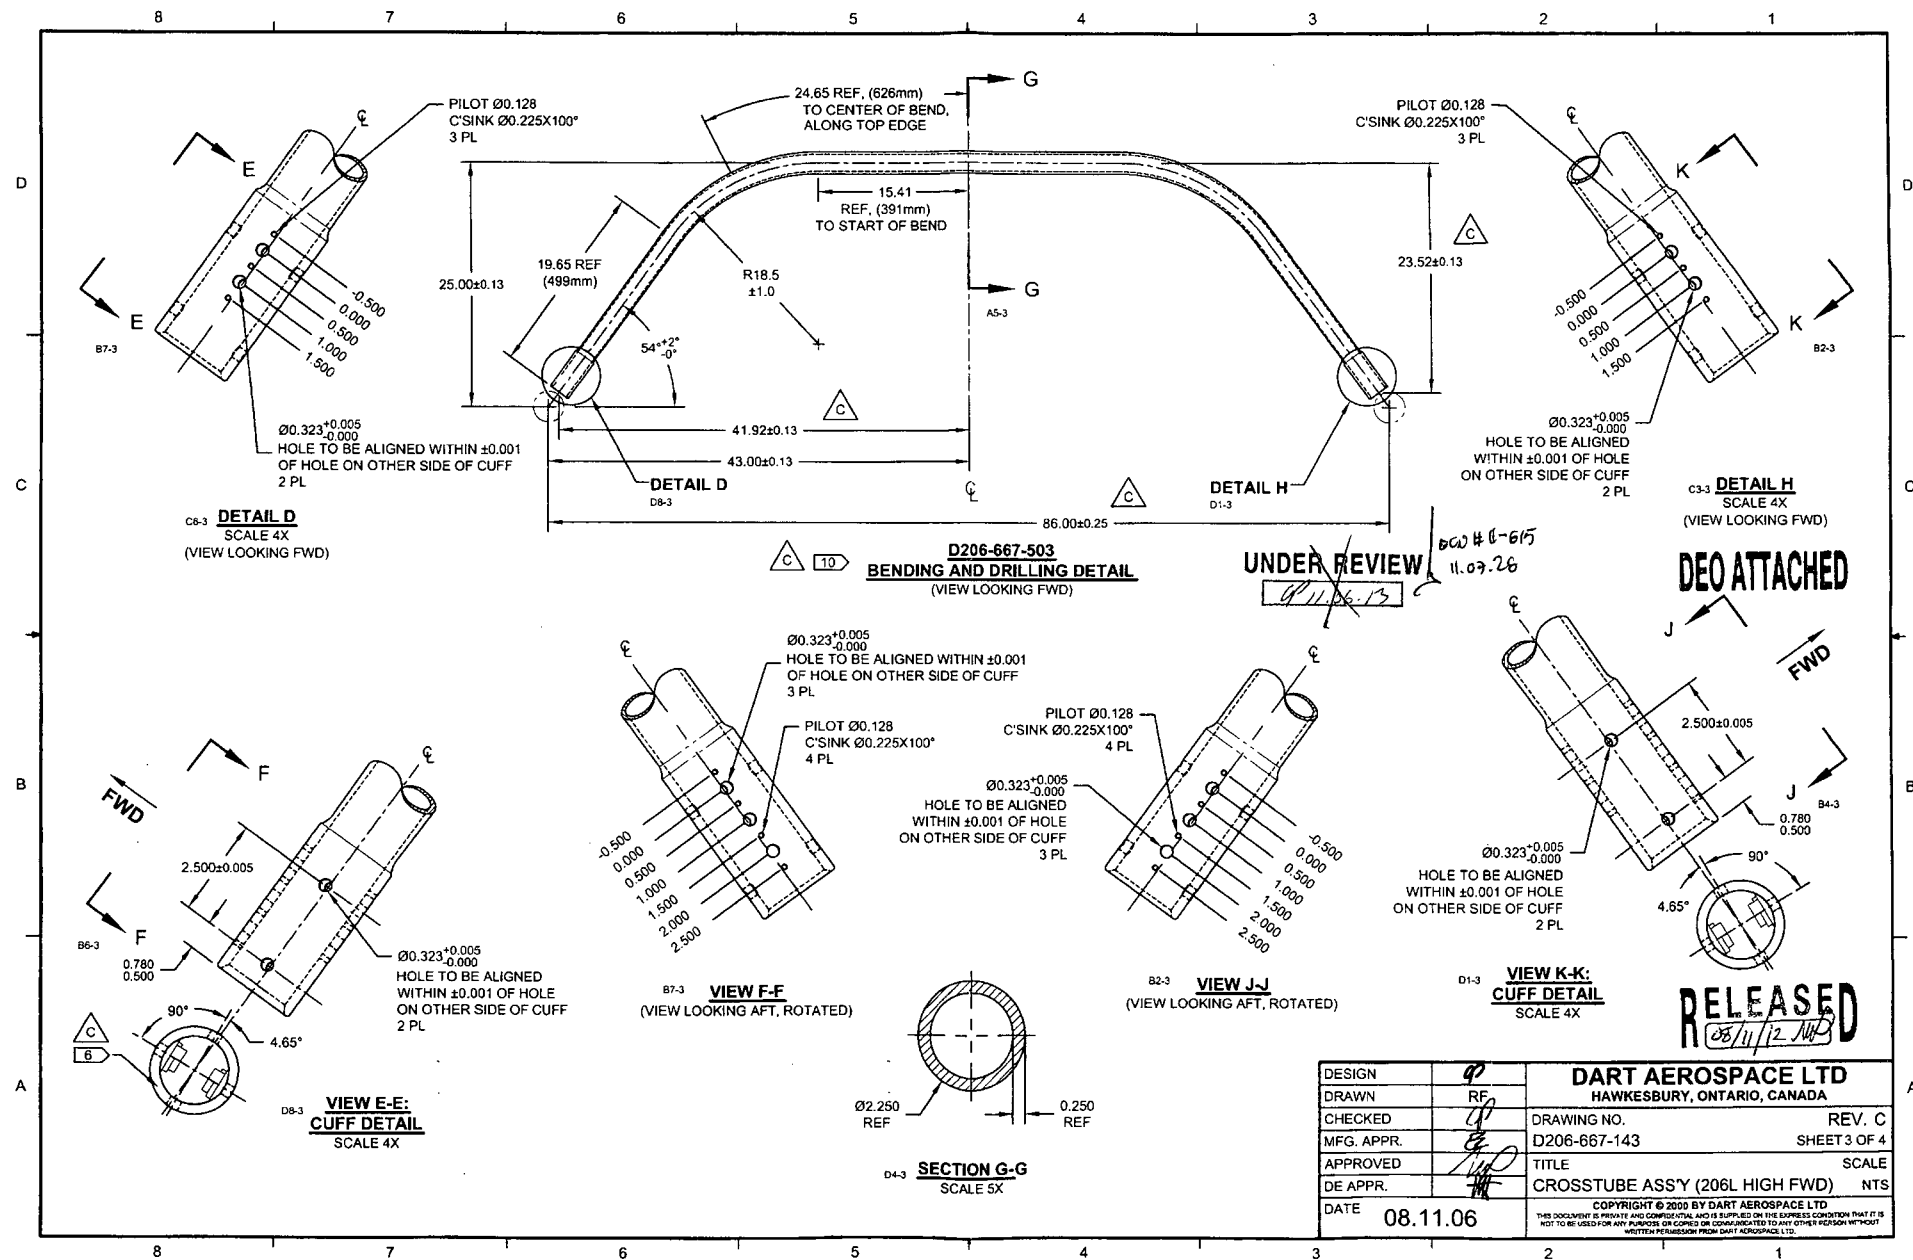

8 7 6 5 4 3 2 1

D

C

B


A

D

C


B

A

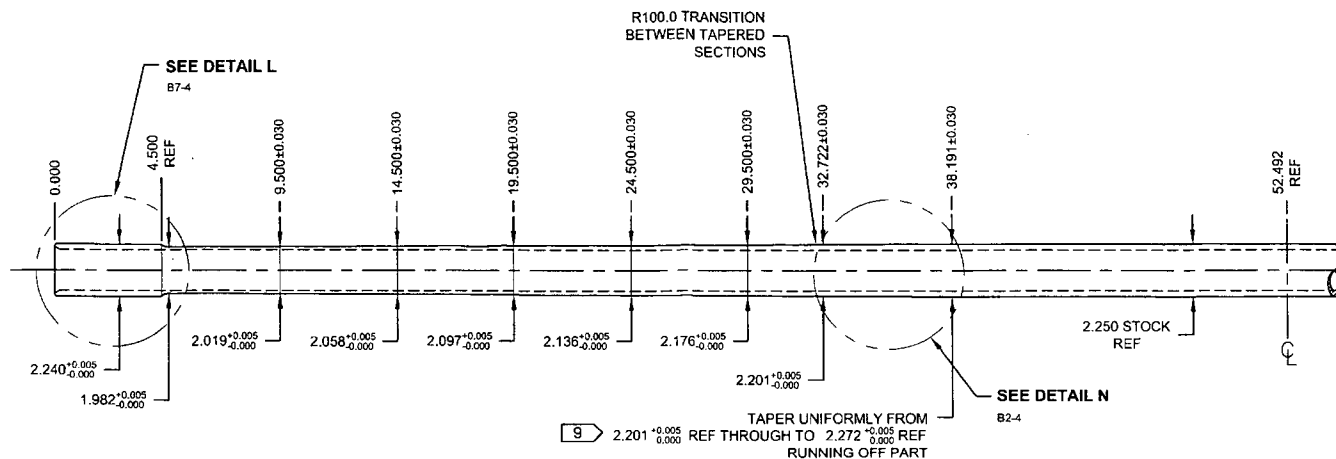


REC'D #11-615  
11.07.26  
UNDER REVIEW  
08/11/13  
DEO ATTACHED


**C TURNING DETAIL**

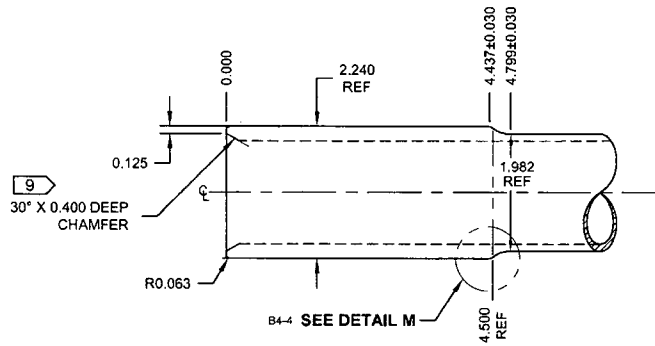

**DETAIL L:  
D7-4 CROSSTUBE CUFF**  
NOT TO SCALE

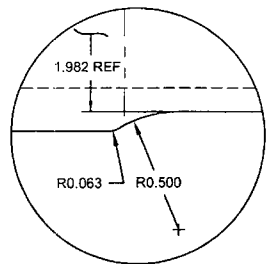

**DETAIL M:  
A6-4 CUFF TRANSITION**  
NOT TO SCALE

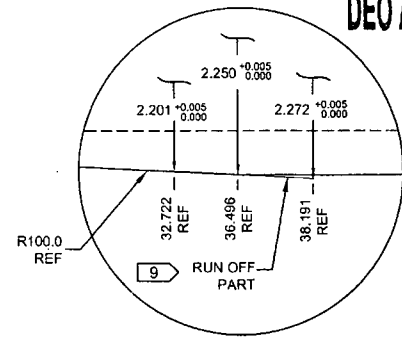

**DETAIL N:  
C4-4 TAPER RUN-OFF**  
NOT TO SCALE

**RELEASED**  
08/11/12

DESIGN	9	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. C
MFG. APPR.	RF	D206-667-143	SHEET 4 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASSY (206L HIGH FWD)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

8 7 6 5 4 3 2 1

DRAWING NO. D206-667-143	TITLE CROSSTUBE ASS'Y (206L HIGH FWD)	REV. C	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D206-667-143-C-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN 9	CHECKED ASS	MFG. APPR. 12	APPROVED MD		DE APPR. #		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE 11.07.21		

**PURPOSE:**

REPLACE MAGNOBOND WITH PROSEAL.

**CHANGE:**

IS:

Item	Qty -143	Part Number	Description
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

12) TO INSTALL D2891-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.

15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.

15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED  
2011-07-28  
LW

# DART SERVICE INSTRUCTION

TO AMEND INSTRUCTIONS FOR CONTINUOUS AIRWORTHINESS ICA-D206-667 Rev. 3 OR LATER  
REF. CANADIAN STC: SH01-5  
REF. FAA STC: SR01304NY  
REF. EASA STC: EASA.IM.R.S.01179

## PURPOSE:

The supports on the following crosstubes are now installed using Proseal instead of Magnobond:

D206-667-101 @ CHG 004  
D206-667-103 @ CHG 005  
D206-667-107 @ CHG 002  
D206-667-201 @ CHG 004

D206-667-203 @ CHG 004  
D206-667-207 @ CHG 002  
D407-667-105 @ CHG 004

## CHANGE:

For the crosstubes listed above, section 32.4 of ICA-D206-667 is amended as follows. Use Figures 32-4 to 32-8 of ICA-D206-667 for further reference. For crosstubes of an earlier change number, it is recommended that if the supports are removed, the supports should be reinstalled using the procedure listed below.




 
### 32.4 SUPPORT INSTALLATION

- 32.4.1 Locate the area on crosstube for installation of support (ref. Figures 32-4 to 32-8 of ICA-D206-667). For D206-667-101/-103/-107/-201 and D407-667-105 crosstubes, the outward face of the support tabs should be 13.08" (332mm) from the crosstube center. For D206-667-203/-207 crosstubes, the outward face of the support tabs should be 10.03" (255mm) from the crosstube center. Ensure paint finish of crosstube is intact; touch up as required per Chapter 5 (5.3.9) of ICA-D206-667.
- 32.4.2 If present, remove any paint/primer on bottom of supports. Abrade mating surfaces of support and crosstube with 400-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.3 Ensure a layer of 3M Scotch-Weld 2216 B/A Epoxy Adhesive is on the bottom of the support. If required, either apply or touch-up support to have a 0.03" to 0.05" thick layer of adhesive over the entire mating surface. Allow supports to cure for 24 hours.
- 32.4.4 Abrade mating surfaces of support (after cure) and crosstube with 180-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.5 Apply a 0.04" to 0.07" thick layer of Proseal 890 Class B or AMS-S-8802 Class B sealant underneath applicable support and install support.
- 32.4.6 Install the clamps opposite to crosstube support as shown in Figures 32-4 to 32-8 of ICA-D206-667. Install rubber cushions underneath each clamp around the bottom circumference of the crosstube up to the crosstube centerline. Torque clamps 80-100 in-lb (9.0-11.3 Nm). It is acceptable to use smaller or larger sized MS21920-XX clamps than those listed in ICA-D206-667, ensure that after torquing the clamps per this instruction, the nuts are in safety but not bottomed out
- 32.4.7 Prior to installing crosstube on aircraft, allow supports to cure for 72 hours and recheck torque on clamps.

CANADA  
DEPARTMENT OF TRANSPORT  
AIRCRAFT CERTIFICATION  
BRANCH  
DAO # 01-O-01

APPROVED  
BY:   
D. SHEPHERD (DE # 02)

DATE: 11.07.20  
CERT. NO.: SH01-5  
ISSUE NO.: 3

A	NEW ISSUE	CP	11.07.15
REV.	DESCRIPTION	BY	DATE
DESIGN		<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
DRAWN			
CHECKED	ASS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9565	SHEET 1 OF 1
APPROVED		TITLE	SCALE
DE APPR.		SUPPORT INSTALLATION CHANGE	NTS
DATE	11.07.15	COPYRIGHT © 2011 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	